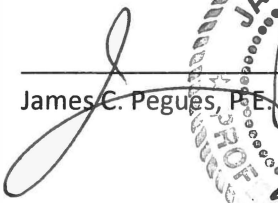



257.83 (b)(2)	REPORT OF ANNUAL INSPECTION OF CCR SURFACE IMPOUNDMENT		
	FACILITY NAME: Plant Smith – Ash Pond		
	OWNER/OPERATOR OF FACILITY: Gulf Power		
	INSPECTION DATE: November 14, 2018		
	INSPECTING ENGINEER: James C. Pegues, P.E. (FL PE# 52519)		
	Based on the results of my inspection and review of the data provided, it is my professional opinion that the report has been completed in accordance with 40 CFR 257.83(b).		
(i)	ANY CHANGES IN GEOMETRY OF THE IMPOUNDING STRUCTURE SINCE THE PREVIOUS ANNUAL INSPECTION?		NO
(ii)	LOCATION AND TYPE OF EXISTING INSTRUMENTATION		NO INSTRUMENTATION
(ii)	MAXIMUM RECORDED READING OF EACH INSTRUMENT SINCE PREVIOUS ANNUAL INSPECTION		N/A
(iii)	APPROXIMATE MINIMUM, MAXIMUM AND PRESENT DEPTH AND ELEVATION OF THE IMPOUNDED WATER SINCE PREVIOUS ANNUAL INSPECTION*		
	MIN. DEPTH: 0 ft	MAX. DEPTH: 9.0 ft	PRESENT DEPTH: 6.4 ft. (at deepest area)
	MIN. ELEVATION: 11.1	MAX. ELEVATION: 16.85	PRESENT. ELEVATION: 10.4
(iii)	APPROXIMATE MINIMUM, MAXIMUM AND PRESENT DEPTH AND ELEVATION OF CCR SINCE PREVIOUS ANNUAL INSPECTION.**		
	MIN. DEPTH: 0 ft	MAX. DEPTH: 15 ft	PRESENT DEPTH: 15 ft (at deepest area)
	MIN. ELEVATION: 2 ft	MAX. ELEVATION: 27.4 ft	PRESENT ELEVATION: up to 27.4 ft
(iv)	APPROXIMATE STORAGE CAPACITY OF IMPOUNDING STRUCTURE AT TIME OF INSPECTION.		3,771,000 yd ³ **
(v)	APPROXIMATE VOLUME OF IMPOUNDED WATER AND CCR AT TIME OF INSPECTION		WATER: <75,000 yd ³ CCR: 3,467,744 yd ³
(vi)	ANY APPEARANCE OF AN ACTUAL OR POTENTIAL STRUCTURAL WEAKNESS OF THE CCR UNIT, IN ADDITION TO ANY EXISTING CONDITIONS THAT ARE DISRUPTING OR HAVE THE POTENTIAL TO DISRUPT THE OPERATION AND SAFETY OF THE CCR UNIT AND APPURTENANT STRUCTURES?		NO
	(IF YES, DESCRIBE):		
(vii)	ANY OTHER CHANGE(S) WHICH MAY HAVE AFFECTED THE STABILITY OR OPERATION SINCE THE PREVIOUS ANNUAL INSPECTION?		NO
	(IF YES, DESCRIBE):		

*Water elevation measured at stoplogs

**Depths, elevations and cubic yard volumes are estimates derived by qualified personnel from available information.

Based on the results of my inspection and review of the data provided, it is my professional opinion that the report has been completed in accordance with 40 CFR 257.83(b).


James C. Pegues, P.E.

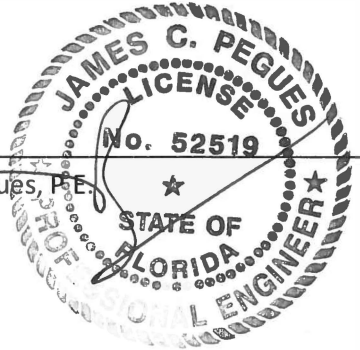

The seal is circular with a double-line border. The outer ring contains the text "JAMES C. PEGUES" at the top and "PROFESSIONAL ENGINEER" at the bottom. The inner ring contains "LICENSE" at the top and "STATE OF FLORIDA" at the bottom. In the center, it says "No. 52519" and "STATE OF FLORIDA" with a star above and below the text.

12/21/18
Date